



Service Bulletin	
PRODUCT:	Refrigerator
TIP NUMBER:	ASC20060504001
TIP DATE:	05/04/2006
MODELS:	RS253BAWW/XAA, RS255BAWW/XAA, RS253BAWW/XAA, RS253BAVQ/XAA, RS253BABB/XAA, RS253BASB/XAA, RS255BABB/XAA, RS255BASB/XAA, RS257BASB/XAA, RS257BAWW/XAA, RS257BABB/XAA, RS257BARB/XAA, RB195LASW/XAA, RB195LAVQ/XAA, RB195LASH/XAA, RB195ZABB/XAA, RB195ZASW/XAA, RB195ZASH/XAA, RB195ZAVQ/XAA, RB195BSBB/XAA, RB195BSBB/XAA, RB195BSSB/XAA, RB195BSSW/XAA, RB195BSVQ/XAA, RB215BSSB/XAA, RB215BSSB/XAA, RB215BSBB/XAA, RB215BSSW/XAA, RB215LABB/XAA, RB215LASH/XAA, RB215LASW/XAA, RB215LABP/XAA, RB215ZABB/XAA, RB215ZASW/XAA, RB215ZASH/XAA, RB215ZAVQ/XAA, RM255BARB/XAA, RM255LASH/XAA, RM255LABP/XAA
Chassis	ATOP, NEXT and W2

SUBJECT: PLC (Power Line Communication) Error in Diagnostic Mode

SYMPTOM: - When Self-Diagnostic mode is selected, the LED segment indicating PLC error may be blinking, see figure 1. PLC error does **NOT** mean the board should be replaced.

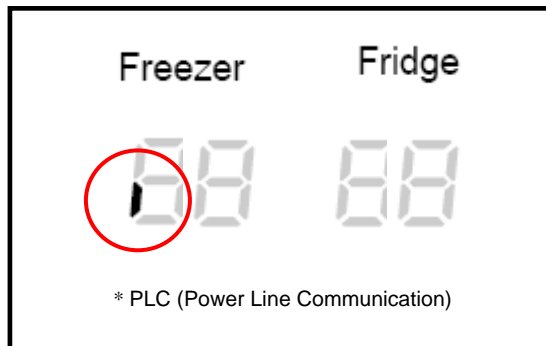


Figure 1

Explanation: The PLC error indicates that the unit was not able to connect to a home network system. These models do not have a home network interface so this error is meaningless. If this error is displayed during diagnostic testing please ignore it.

Note: Consult the Samsung Service Website at (service.samsungportal.com) for the Service Manual and other information on this product.